

December 3, 2001



S-02-02

SERVICE BULLETIN

This Service Bulletin is located on the web at: www.polarisdealers.com

Subject

Edge[®] Reverse Chaincase Needs Cover Bracket

Purpose

The possibility exists that the extended ear on the chaincase cover of all 2002 Edge[®] models with manual reverse may break due to deflection of the extended ear when shifting into or out of reverse. A bracket has been developed to add strength to the extended ear to reduce the possibility of breakage.

Models Affected:

All 2002 Edge[®] Models with Manual Reverse

Parts Required

Qty.	Part Description	Part No.
1	Bracket-Reverse Cover	1341440

Repair Procedure

Replace the 3/8x24 lock nut PN 7542439 (photo 1) with bracket PN 1341440 which uses the chaincase for added strength. Re-assemble the shifting mechanisms and apply Loctite[®] 242 (blue) to the threads of the bolt. Tighten the bolt (PN 7515415) to 120 in. lbs. (13.56 Nm).

Customer Notification

Please perform this Service Bulletin on all affected units in your inventory. Contact owners of delivered units immediately and make arrangements to perform this warranty repair.

Warranty Claim Preparation

A single group claim may be submitted listing the serial number and date of repair for all machines with the same model number. DO NOT PUT MORE THAN ONE MODEL NUMBER ON A CLAIM.

File Claim Type SB (Service Bulletin) for all affected models.

Warranty Labor Allowance: :15 for each machine serviced.

Fail Code: Use fail code 1127 during claim preparation.

Sincerely,

POLARIS SALES INC.

Rick Huseman
Manager, National Service Center

